FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE

NUMBER: 04-2-MPU-IM2 -X

SUBSYSTEM NAME: AUXILIARY POWER UNIT (APU)

REVISION: BASIC 07/17/98

PART DATA

PART NAME VENDOR NAME

PART NUMBER VENDOR NUMBER

LRU

: AUXILIARY POWER UNIT (APU)

MC201-0001-06XX

SUNDSTRAND

729867XX/754949

SRU

:MAGNÉTIC PICK UP UNIT

SMITH INDUSTRIES

5911014

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

MAGNETIC PICK-UP UNIT (APU TURBINE SPEED SENSOR) MPU1, MPU2, MPU 3. THE MAGNETIC PICK-UP (MPU) CONTAINS A MAGNETIC POLEPIECE AND WIRE COIL ASSEMBLY. THE POLEPIECE IS PLACED NEAR THE BEARING SPACER OF THE APU TURBINE WHEEL. AS THE TURBINE WHEEL ROTATES, TWO AXIAL GROOVES ON THE BEARING SPACER ALTER THE MAGNETIC FLUX THROUGH. THE POLEPIECE AND WIRE COIL. THE CHANGING MAGNETIC FLUX INDUCES A VOLTAGE PULSE IN THE COIL, AND THIS PULSE (TWO PER REVOLUTION) IS DETECTED BY THE MPU FILTER AND COMBINE. BOARD OF THE IAPU CONTROLLER.

QUANTITY OF LIKE ITEMS: 9

THREE PER APU

FUNCTION:

MONITOR TURBINE SPEED TO PROVIDE FEEDBACK TO THE SPEED CONTROLLER CIRCUIT OF THE APU-1005 (IMPROVED) CONTROLLER (REFERENCE 04-2-CONTL1-IM/ CONTL2-IM/CONTL5-IM).

THE MPUS SUPPORT THE IMPROVED CONTROLLER "VOTING CIRCUIT." THE "VOTING CIRCUIT' GENERATES A FOURTH MPU SIGNAL OUTPUT FROM ANY TWO (OF THE THREE) MATCHING MPU SIGNALS.

FAILURE MODES EFFECTS ANALYSIS FMEA - CIL FAILURE MODE

NUMBER: 04-2-MPU-IM2-11

REVISION#: BASIC 07/17/98

SUBSYSTEM NAME: AUXILIARY POWER UNIT (APU)

LRU: AUXILIARY POWER UNIT (APU)

CRITICALITY OF THIS

ITEM NAME: MAGNETIC PICKUP UNIT

FAILURE MODE: 1R3

FAILURE MODE:

LOSS OF OUTPUT, ERRONEOUS OUTPUT, INTERMITTENT OUTPUT

MISSION PHASE:

PL PRE-LAUNCH

LO LIFT-OFF

DO DE-ORBIT

LS LANDING/SAFING

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDEAVOUR

CAUSE:

INTERNAL FAILURE, BROKEN WIRE, SHORT TO GROUND.

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) FAIL

C) PASS

PASS/FAIL RATIONALE:

CONTROLLER CHECKOUT UNIT (CCU) VERIFIES CONTINUITY DURING EACH VEHICLE TURNAROUND.

B)

FAILS SCREEN "8" BECAUSE ONLY ONE OF THE THREE MPUS (MPU#3) IS MONITORED BY INSTRUMENTATION (V46R0X35A).

C)

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL FAILURE MODE NUMBER: 04-2-MPU-IM2- 11

- FAILURE EFFECTS -

(A) SUBSYSTEM;

NO EFFECT, EXCEPT IF MPU 3 IS LOST (TURBINE SPEED MONITORING IS LOST). LOSS OF SPEED CONTROL REDUNDANCY. FAILURE OF TWO MPUS RESULTS IN LOSS OF ONE APU FOR REMAINDER OF MISSION.

(B) INTERFACING SUBSYSTEM(S):

LOSS OF TWO MPUS WILL RESULT IN LOSS OF ONE APU AND SHAFT POWER TO HYDRAULIC PUMP.

(C) MISSION:

ABORT DECISION IS POSSIBLE IF MPU FAILURE COMBINED WITH A SECOND FAILURE (CONTROLLER, OR MPU) RESULTS IN LOSS OF SPEED CONTROL DURING POWERED FLIGHT (TIMING AND FLIGHT TRAJECTORY DEPENDENT).

(D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT UNTIL SECOND APU LOSS. POSSIBLE LOSS OF VEHICLE IF TWO OUT OF THREE APU'S ARE LOST. LOSS OF ONE APU DURING POWERED FLIGHT WILL RESULT IN THE ASSOCIATED SSME GOING INTO HYDRAULIC LOCK-UP AND COULD RESULT IN LOSS OF ORBIT CAPABILITY OR BE CATASTROPHIC (WITH ADDITIONAL SSME VALVE FAILURE). (REF. FLIGHT RULE A10.1.2-5).

(E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF VEHICLE IF TWO OF THREE APU'S ARE LOST

- LOSS OF 1 OF 3 MPU'S: LOSS OF 1 OF 2 SPEED CONTROL PATHS.
- LOSS OF 2 OF 3 MPU'S: LOSS OF APU
- LOSS OF SECOND APU: POSSIBLE LOSS OF CREW/VEHICLE

-DISPOSITION RATIONALE-

(A) DESIGN:

COIL AND LEAD WIRE SOLDERED TO COPPER STRIP. POTTED ASSEMBLY, NO DYNAMIC PARTS. FEATURES FEWER COIL TURNS (750 VS. 6,000), INCREASE COIL WIRE GAUGE (#40), AND SOLDER CONNECTIONS ARE WRAPPED IN TAPE TO PREVENT DIRECT CONTACT WITH THE POTTING MATERIAL

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL FAILURE MODE NUMBER: 04-2-MPU-IM2- 11

(B) TEST:

ATP PERFORMED AT SUPPLIER INCLUDED INSULATION RESISTANCE (IR) AND DIELECTRIC TEST, DC RESISTANCE, OUTPUT VOLTAGE, POLARITY, AND BURN-IN (THERMAL CYCLE AND VIBRATION). MPU QUALIFIED WITH APU.

CERTIFICATION TESTS CONDUCTED WERE 75 HRS. APU OPERATION, 250 THERMAL CYCLES, AND 250 HRS. OPERATING TIME (VIBRATION)

CONTINUITY IS VERIFIED BY CCU TEST AND BIT EVERY FLOW. VERIFICATION OF OUTPUT VOLTAGE AND POLARITY PERFORMED AFTER FIELD REPLACEMENT DURING GROUND HOTFIRE.

OMRSD: ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

RECEIVING INSPECTION

MATERIAL AND PROCESSES CERTIFICATIONS ARE VERIFIED.

CONTAMINATION CONTROL

CLEANLINESS PER REQUIREMENTS IS VERIFIED BY INSPECTION. CORROSION PROTECTION REQUIREMENTS ARE VERIFIED BY INSPECTION. INCLUDING PASSIVATION OF HOUSINGS, HERMETIC SEAL OF UNIT BY TIG WELD, AND ENCAPSULATION OF THE UNIT.

ASSEMBLY/INSTALLATION

MANUFACTURING, ASSEMBLY, AND INSTALLATION REQUIREMENTS ARE VERIFIED BY INSPECTION. DIMENSIONS AND SURFACE FINISHES ARE VERIFIED BY INSPECTION.

CRITICAL PROCESSES

INSPECTION VERIFIES TIG WELDING, BRAZING, SOLDERING, CRIMPING, HEAT TREATING, AND BRASS FERRULE TIN PLATING.

TESTING

TEST EQUIPMENT AND TOOL CALIBRATION ARE VERIFIED BY INSPECTION. ATP IS WITNESSED AND VERIFIED BY INSPECTION.

HANDLING/PACKAGING

HANDLING, PACKAGING, STORAGE, AND SHIPPING PROCEDURES ARE VERIFIED.

(D) FAILURE HISTORY:

REFER TO PROBLEM REPORTING AND CORRECTIVE ACTION (PRACA) FAILURE HISTORY DATABASE.

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: 04-2-MPU-IM2- 11

(E) OPERATIONAL USE:

LOSS OF ONE APU MAY RESULT IN SWITCHING TO HIGH SPEED AND INHIBIT ON OTHER TWO APUS; DEPENDING ON MISSION PHASE.

-IF APU SHUTS DOWN DURING ASCENT, REMAINING APUS ARE COMMANDED TO HIGH SPEED AND AUTOMATIC SHUTDOWN IS INHIBITED TO PRECLUDE INADVERTENT SHUTDOWNS.

-IF AN APU SHUTS DOWN DURING DESCENT, REMAINING APUS ARE COMMANDED TO HIGH SPEED AT TAEM AND AUTO SHUTDOWN REMAINS ENABLED.

- APPROVALS -

BOEING DESIGN

BOEING S-SYSTEM MGR BOEING SS&PAE MGR

BOEING SAFETY ENGINEER

BOEING RELIABILITY ENG

NASA/JSC_MOD

USA DRBITER

USA SAM

: B. BARRERA

: TIBOR FARKAS

: POLLY STENGER

: GLORIA CAMACHO

: DAN HUNTER

: MEL FRAINT

M.J. Buybackt 4/24/00